



TYPICAL STAIR TREAD DETAIL F SCALE:I"=I'



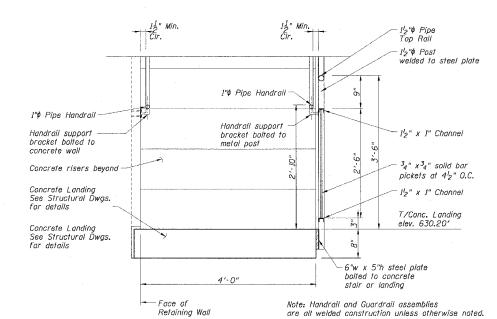

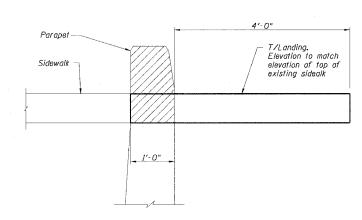

Note: Handrail not shown. See Detail D and Section B-B for details.



NOTES:

- 1. For Plan and Sections, see Dwg. No. SST-1.
- Do not cut existing wingwall reinforcing bars when drilling holes for drilled and epoxied reinforcing bars. Locate reinforcing bars prior to drilling holes by use of a pachometer or by chipping concrete away to expose face of reinforcing bars.
- 3. Use a two part epoxy adhesive, Hit Re 500 Adhesive Anchor System as manfactured by Hilli for anchoring reinforcing bars in holes drilled into the existing wingwall.
- 4. Do not remove forms, shoring and falsework for stairs until concrete has attained a minimum compressive strength of 4000 psi at 28 days and the concrete has been in place for a minimum of 28 days.

REVISION	
DATE	DESCRIPTION

FR-416 SST-2

SHEET 154 OF 167

PLANS PREPARED BY:

303 East Wacker Drive, Suite 600, Chicago, Illinois 60601-5276 T 312.938.0300 F 312.938.1109 www.cte.aecom.com